

16198A-01

Modification Available Performance Enhancement Service Note

Supersedes:
None

16198A Bottom Electrode SMD Test Fixture

Serial Numbers: MY55100100 / MY55100155

The screws which fix the DUT cover and PC board strip out

Parts Required:

P/N	Description	Qty.
16198-60113	Sub-Assembly, DUT Cover	1
0515-1077	Screws Hex-Socket M2X0.4 5mm	8
8710-2834	Hex-bit 1.5mm	1


Situation:

The hole of screws which fix the DUT cover and PC board may strip out. (four screws of No.1 and No .2 in the figure) while installing

ADMINISTRATIVE INFORMATION

<input type="checkbox"/> Calibration Required	PRODUCT LINE: WN
<input checked="" type="checkbox"/> Calibration NOT Required Calibration NOT Required	AUTHOR: YH

ADDITIONAL INFORMATION:

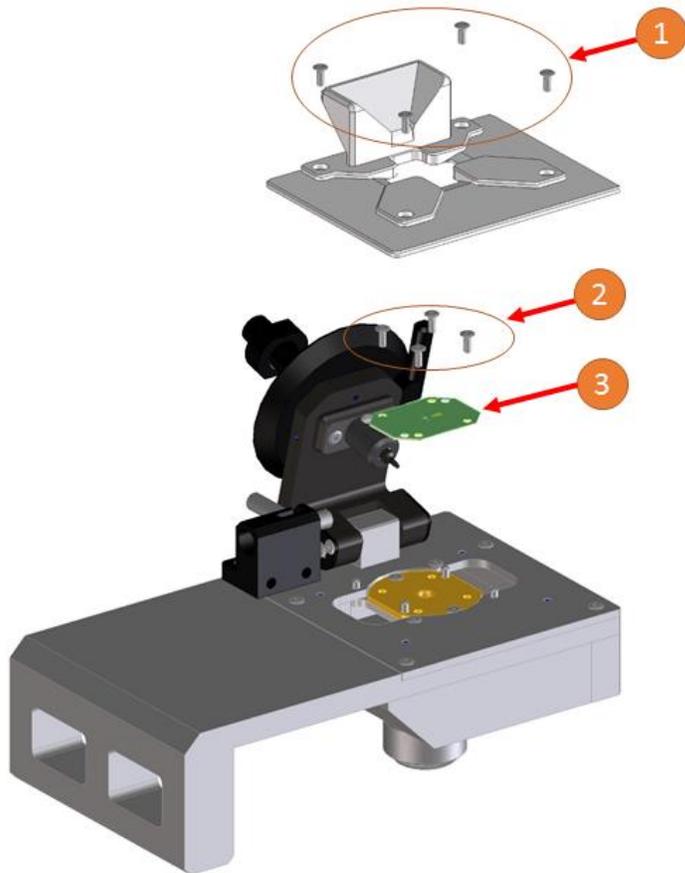


Solution/Action:

Screw has been change to one with the stronger and bigger hole to avoid them stripping out. Due to the change of screw, the DUT cover and the Hex-bit for the torque driver are also changed.

Replace 8 screws and DUT cover with new ones.

Difference between old and new for DUT cover and screws.

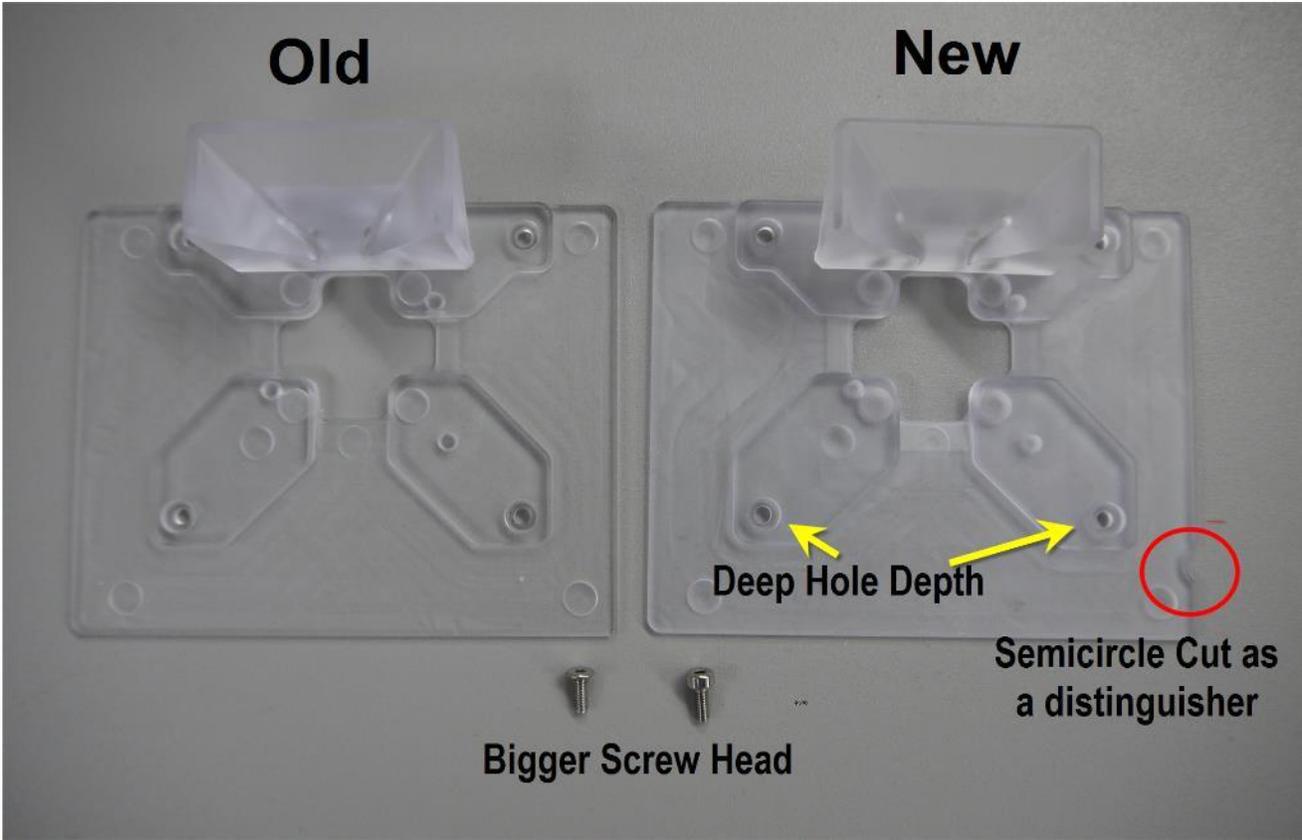

Revision History:

Date	Service Note Revision	Author	Reason for Change
09 Jan 2019	01	Yoichiro Hayashi	As Published