# A MODIFICATION ONLY - DOES NOT COMMUNICATE

4396B-13

## <u>SERVICE NOTE</u>

Supersedes: [None]

### Agilent 4396B RF Network/Spectrum/Impedance Analyzer

**Serial Numbers: See Solution / Action** 

**Part Number Changes for Power Supply Switch Parts** 

**Parts Required: See Solution / Action** 

To Be Performed By: Agilent-Qualified Personnel

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

### **INFORMATION ONLY**

AUTHOR: TO PRODUCT LINE: WN

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2002 PRINTED IN U.S.A.





Page 2 of 3 4396B-13

#### **Situation:**

The power switch holder (P/N 04396-01274) and the power switch assembly (P/N 04396-61701) for the 4396B were obsoleted and replaced with new parts. Additionally, a new rod (P/N 04194-40001), which is inserted between the switch and LINE push-button, is set up.

#### **Solution/Action:**

When replacing the swich holder or the switch assembly, order appropriate parts depending on the serial number of the 4396B.

### Serial Number: JP1KE01207 and below

When either the switch holder (P/N 04396-01274) or the switch assembly (P/N 04396-61701) is faulty, replace all the parts listed in Table 1 with the new parts shown in Table 2. Insert the rod (P/N 04194-40001) between the power switch and LINE push-button as shown in Figure 1.

### Serial Number: JP1KE01208 and above

New switch holder and switch assembly are used in the 4396B. When replacing the switch assembly, holder or rod, use the replacement parts listed in Table 2.

**Table 1 Old Parts (obsoleted)** 

Part Number	Qty.	Description
04396-01274	1	Switch Holder
04396-61701	1	Switch Assembly
0515-0868	2	Screw fixing 04396-01274 on the chassis

**Table 2 New Replacement Parts** 

Part Number	Qty.	CPL Description
04396-01276	1	Switch Holder
04396-61702	1	Switch Assembly
04194-40001	1	Rod for 04396-61702
0515-1719	2	Screw fixing 04396-01276 on the chassis

Page 3 of 3 4396B-13

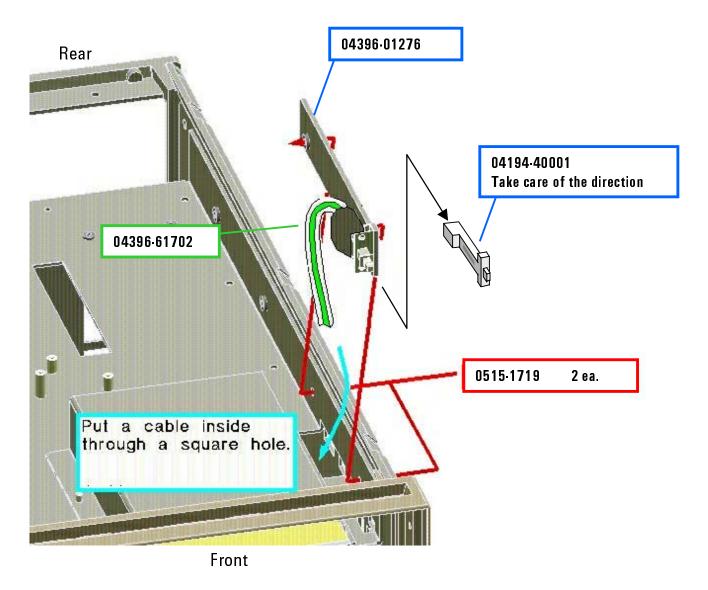


Figure 1 Replaceable Parts from Bottom View