

## S E R V I C E N O T E

## HP Model 4800A Transformer Wiring

A minor wiring error has been discovered in 4800A. The effect of the error is to place the Power On indicator directly across the input line at all times. In 230-volt line operation the lamp life is shortened to about 60 hours.

The error can be identified by the presence of a red wire on pin 4 of the power transformer. To correct the wiring, move the red wire from pin 4 to pin 3 on the transformer.

WW:keg

6/69-10

Customer Service • 333 Logue Avenue, Mountain View, California 94040. Tel. (415) 968-9200  
Europe: 54 Route Des Acacias, Geneva, Switzerland. Cable: "HEWPACKSA" Tel. (022) 42.81.50

HEWLETT  PACKARD