S E R V I C E N O T E

SUPERSEDES: None

HP 4981A Network Advisor

Serial Numbers: 0000A00000 / 3132A00696

Duplicate Service Notes:

4980A-09 4982A-09

J2171A Ethernet Interface/Main Network Board/5062-2178

Modification To Resolve "Boot Up/Timeout Errors"

To Be Performed By: HP-Qualified Personnel

Parts Required:

Part Number Description

5062-9617 Main Network Interface Board

Situation:

Instruments can experience intermittent bootup errors associated with the main board in the network interface. The errors occur because during reset modes, an error counter sometimes does not get reset. This causes the counter to reach its limit resulting in the boot up errors. Some boards may already have the modification performed on them. See the "Inspection Section" for mod location on the network board.

Continued

DATE: 05 October 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR: 1.0 Hour	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ☐ HP LOCATION	SERVICE	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	RESPONSIBLE UNTIL : 04 October 1994	
AUTHOR: RCB	ENTITY: 3800	ADDITIONAL INFORMATION:	

© 1992 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Page 2 SERVICE NOTE 4981A-09

The most common bootup error message which will appear will be

"ARTFATALerrormajorcode = 2120 or 2121"

Solution/Action:

Using the service documentation as reference, replace the main board in the network interface using the bluestripe board. The part number is mentioned above.

Inspection

Some of the instruments may already have had this modification completed. An inspection of the main network interface board will tell whether or not the mod needs to be completed. Looking at the component side of the main interface board with the SIMMS towards the top, if there are 4 wires to the right of the SIMMS and to the left of the ROM, the mod has already been performed.