## S E R V I C E N O T E

SUPERSEDES: None

### HP 54714A Dual-Channel, Amplifier Plug-In

**Serial Numbers:** 0000A00000/US3451999

**Duplicate Service Notes:** 54713A/B-01

54715A-01

# Attenuator replacement requires front-casting modification and a shorter mounting screw

#### **Situation:**

Replacement attenuator, part number 54512-63402, now requires a round mounting hole in the plug-in's front panel casting and a shorter attenuator mounting screw.

Continued

DATE: July 1997

#### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICAT	TION:	
	INFORMATI	ON ONLY
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
RK	0800	

© 1997 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Page 2 Service Note 54714A-01

#### **Solution/Action:**

Use a round file to round out the front-panel casting's channel input hole to allow mounting the new attenuator. The new attenuators have a pressed-in BNC connector that requires the round mounting hole. Position the plug-in on its side to keep the metal filings out of the plug-in when filing out the front-panel hole. Use a 0515-0430 mounting screw to mount the attenuator front to the circuit board. A longer screw can damage and short the channel input.

#### **Parts Required**

Part Number	Qty	Description
0515-0430	1	Machine Screw M3 6mm-Lg Pan-Hd T10