# A MODIFICATION ONLY - DOES NOT COMMUNICATE

54831-03

## <u>SERVICE NOTE</u>

Supersedes: NONE

54831B

**Serial Numbers: ALL** 

Error's in service manual 54830-97001.

**Parts Required:** 

P/N Description Qty.

**NONE** 

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

## **INFORMATION ONLY**

AUTHOR: QV PRODUCT LINE: 1A

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2002 PRINTED IN U.S.A.



Page 2 of 2 54831-03

#### **Situation:**

Error in service manual 54830-97001.

- 1. There is no CD-ROM removal Procedure. Use the procedure in the 54845B/46B service manual until revision comes out.
- 2. External Trigger Sensitivity is as follows:
  - a. Dc to 100MHz: 0.05x(signal range)
  - b. 100MHz to 500MHz: 0.10x(signal range)
- 3. Input Impedance (resistance) is as follows:
  - a. 50 Ohm: =/- 1.0%
- 4. DC Calibrator Specifications
  - a. Performance test record result should be between .998 an 1.002
- 5. Time Measurement Accuracy Specification
  - a. Equivalent Time: (>= 16 averages)

+/-[(0.0015 \* dT) + (full scale/(2\*memory depth)) + 30ps]

- 6. Replacement Part Number Errors
  - a. A14 2090-0365 not available use A13 2090-0396.
  - b. A4 86100-66517 needs to be 54810-66541.
  - c. B1 3160-0644 needs to be 3160-4134.
  - d. W3 54801-61640 needs to be 54810-61618
  - e. W4 54810-61601 needs to be 54810-61621.
  - f. H14 0515-0456 needs to be 0380-4445.

#### **Solution/Action:**

There will be an updated manual release around May 2002. Until then just use this service note as your information to correct these errors.