

S E R V I C E N O T E

SUPERSEDES: 6030A-14

6030A System Autoranging DC Power Supply

Serial Numbers: 0000A00000 / 9999A99999

A1U1 Rectifier Bridge Replacement

Duplicate Service Notes:

- 6010A-07A
- 6011A-08A
- 6012B-06A
- 6015A-04A
- 6030A-14A
- 6031A-06A
- 6032A-15A
- 6035A-05A

To Be Performed By: Agilent-Qualified Personnel

Situation:

A1U1 Rectifier Discontinued

Solution/Action:

A1U1 part number 1906-0218 has been discontinued, no longer manufactured, and has been replaced by part number 1906-0389. The new part 1906-0389 is not mechanically interchangeable with part number 1906-0218. The A1 board has been modified to accept either part.

Continued

DATE: 28 September 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
INFORMATION ONLY		
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
BH	2100	

Replacement should be as follows. All A1 assemblies part number 06030-60021 or 06030-61021 with Revision letter A, B, or C use part number 1906-0218 for A1U1. All A1 assemblies part number 06030-60021 or 06030-61021 with Revision letter D or greater use part number 1906-0389 for A1U1. Although Rev. D boards can use either part 1906-0218 or 1906-0389 it is recommended that only part 1906-0389 be used in Rev. D boards. The A1 board revision letter is printed on the top right rear of the board next to the J5 ribbon cable.