

S E R V I C E N O T E

SUPERSEDES: None

6626A System DC Power Supply

Serial Numbers: 3219A00864 / 3219A00962

* Exclude serial numbers listed below that are already modified.

Unit blows fuses F300 and F305

To Be Performed By: Agilent-Qualified Personnel

Parts Required: Fuse 7 Amp Slow Blow 2100-0916, Qty 8

Situation:

The turn-on inrush current may blow the rail fuses F300 and F305. If the fuses blow, the unit displays "HDW ERR CH" on the front panel display.

Solution/Action:

Remove the original F300 and F305 fuses and replace them with the new 7 Amp "Slow Blow" fuses on each output board. F301 and F306 are no longer used.

To avoid having to recalibrate the supply, insure that each output board is returned to its original position.

After replacing the fuses, check that the supply passes self test and the verification test in the operating manual.

Continued

DATE: 08 October 1992

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 1.0 Hour
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
		USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: November 1995	
AUTHOR: DF	ENTITY: 2100	ADDITIONAL INFORMATION:	

*** Units already modified:**

3219A-00873
-00894
-00895
-00898
-00902

3219A-00910
-00915
-00917
-00919
-00924

3219A-00926
-00930
-00932
-00933
-00935

3219A-00939
-00941
-00944
-00949
-00952

3219A-00954
-00956
-00959
-00961