# S E R V I C E N O T E

SUPERSEDES: None

# 83640L Synthesized Sweeper 10 MHz to 40 GHz

**Serial Numbers:** See Below

# Band 5 and 6 YTM adjustment settings

# **Duplicate Service Notes:**

83640A-05 3145A00000 / 9999Z99999 83640B-05 3145A00000 / 9999Z99999 83640L-05 3145A00000 / 9999Z99999

Parts Required: No

#### **Situation:**

In the YTM and YTF adjustment sections, the 8364x start / stop frequencies for band 5 and 6 adjustments are not correct.

#### **Solution / Action:**

Make the following changes to the 8360B/L Service Guide, part numbers 08360-90125 and to the 8360A Service Guide 08360-90049. The page numbers shown are for the 836B/L Service Guide only.

Continued

DATE: December 1997

#### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
INFORMATION ONLY		
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
DM	5320	

© 1997 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Page 2 Service Note 83640L-05

All the corrections are made in Chapter 3 Adjustments.

# **To page 3-45:**

Amplifier/Multiplier Adjustment Band 5 Adjustment (83640x /50x only). Start 26.5 GHz Stop 30.1 GHz (83640x) Start 26.5 GHz Stop 40 GHz (83650x)

# **To page 3-45:**

Band 6 Adjustment (83640x /50x only). Start 30 GHz Stop 40 GHz (83640x) Start 33.4 GHz Stop 38 GHz (83650x)

### **To page 3-69:**

Amplifier/Filter Adjustment (83640x/50x only). Band 5 Adjustment (83640x/50x only). Start 26.5 GHz Stop 30.1 GHz (83640x) Start 26.5 GHz Stop 40 GHz (83650x)

### **To page 3-69:**

Band 6 Adjustment (83640x /50x only). Start 30 GHz Stop 40 GHz (83640x) Start 33.4 GHz Stop 38 GHz (83650x)