S E R V I C E N O T E

SUPERSEDES: 83751A-03

83751A Synthesized Sweeper

Serial Numbers: See below

4.5 Boot ROM bug

Duplicate Service Notes:

83751A-03A Serial Number: 0000A00000 / 3447A99999 83751B-02A Serial Number: 0000A00000 / 3447A99999 83752A-03A Serial Number: 0000A00000 / 3447A99999 83752B-03A Serial Number: 0000A00000 / 3447A99999

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/NDescriptionQuantity83750-60081Boot ROM Upgrade Kit1

Situation:

A bug exists in rev. 4.5 boot ROMs that cause a situation where external leveling does not work correctly. To recover from the problem, the SRAM needs to be cleared. A new boot ROM set with rev. 4.6 corrects the problem. Also, other rendom problems have been reported that changing the boot ROMs has corrected. The boot ROM revision number is displayed in the frequency window each time the instrument is turned on.

Continued

DATE: August 1998

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ■ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: August 15, 2000
AUTHOR: DMc	ENTITY: 5320	ADDITIONAL INFORMATION: None

© 1998 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Solution / Action:

Anytime an instrument is in for repair and has boot ROM rev. 4.5, upgrade the boot ROMs to rev. 4.6 by installing the Boot ROM Upgrade kit. The price of the upgrade kit (matrial charges) should be charged to extended warranty. If the parts are installed at an Agilent Service Center, labor charges are also covered. The boot ROMs are located on the A4 CPU assembly reference designators U5 and U25.