

S E R V I C E N O T E

SUPERSEDES: 83752A-03

83752A Synthesized Sweeper**Serial Numbers:** See below**4.5 Boot ROM bug****Duplicate Service Notes:**

83751A-03A Serial Number: 0000A00000 / 3447A99999
 83751B-02A Serial Number: 0000A00000 / 3447A99999
 83752A-03A Serial Number: 0000A00000 / 3447A99999
 83752B-03A Serial Number: 0000A00000 / 3447A99999

To Be Performed By: Agilent-Qualified Personnel**Parts Required:**

P/N	Description	Quantity
83750-60081	Boot ROM Upgrade Kit	1

Situation:

A bug exists in rev. 4.5 boot ROMs that cause a situation where external leveling does not work correctly. To recover from the problem, the SRAM needs to be cleared. A new boot ROM set with rev. 4.6 corrects the problem. Also, other random problems have been reported that changing the boot ROMs has corrected. The boot ROM revision number is displayed in the frequency window each time the instrument is turned on.

Continued

DATE: August 1998

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ☒ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ☒ SERVICE CENTER	SERVICE INVENTORY: ☐ RETURN ☐ SCRAP ☐ SEE TEXT	USED PARTS: ☐ RETURN ☐ SCRAP ☐ SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: August 15, 2000
AUTHOR: DMc	ENTITY: 5320		ADDITIONAL INFORMATION: None

Solution / Action:

Anytime an instrument is in for repair and has boot ROM rev. 4.5, upgrade the boot ROMs to rev. 4.6 by installing the Boot ROM Upgrade kit. The price of the upgrade kit (material charges) should be charged to extended warranty. If the parts are installed at an Agilent Service Center, labor charges are also covered. The boot ROMs are located on the A4 CPU assembly reference designators U5 and U25.