## S E R V I C E N O T E

SUPERSEDES: None

## **HP 8751A Network Analyzer**

**Serial Numbers:** 0000J00000 / 3146J00701

0000A00000 / xxxxAxxxxx (To be advised later)

(Firmware Revision 4.01 and below)

# Modification to prevent the HP 8751A from hanging up when being controlled by a controller.

To Be Performed By: HP-Qualified Personnel

### Parts Required:

HP Part No. Qty. Description

W/O Opt.002 W/ Opt.002

08751-86901 08751-86602 1 A1 ROM set Rev.4.02 08751-86403 08751-86403 1 A2 ROM set Rex.4.02

#### Situation:

The HP 8751A may hang up or reset, when the 8751A repeats the same measurement under the computer-controlled circumstances. Check if this service note can be applied to your case, refer to the following situation list (you must have ALL the situations listed below):

Continued

DATE: 30 November 1992

#### **ADMINISTRATIVE INFORMATION**

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE □ AGREEABLE TIME	STANDARDS: LABOR: 1.0 Hour		
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ HP LOCATION	SERVICE ☐ RETURN USED ☐ RETURN INVENTORY: ☐ SCRAP PARTS: ☐ SCRAP SEE TEXT ☐ SEE TEXT		
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	RESPONSIBLE UNTIL: 30 November 1994		
AUTHOR: MT	ENTITY: 3355	ADDITIONAL INFORMATION:		

© 1992 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Page 2 SERVICE NOTE 8751A-14

- 1. The HP 8751A is controlled by an external controller through the HP-IB interface.
- 2. The HP 8751A repeats the same measurement.
- 3. The HP 8751A hangs up and resets after several hours or several days.
- 4. This symptom happens regularly.

#### **Solution/Action:**

It is fixed from the firmware Rev.4.02. Replace ROMs on the A1 and A2 boards with Rev.4.02 ROMs.

#### Procedure:

- 1. Turn the HP 8751A on. The firmware revision will be displayed. Check the firmware revision.
- 2. Remove the top cover and shield plate.
- 3. If the revision is "Rev.4.xx",
  - a. Remove only the A1 board.
  - b. Replace the ROMs of the A1 board with Rev.4.02 ROMs. Table 1 and Figure 1 show the ROM locations.
- 4. If the revision is "Rev.3.xx" and below,
  - a. Remove the A1 and A2 boards.
  - b. Replace the ROMs of the A1 and A2 boards with Rev.4.02 ROMs. The ROM locations are shown in Table 1, Table 2 and Figure 1.
  - c. The Figure 1 shows the jumper and bit switch settings for Rev.4.02. In case of any difference, replace RAMs and change the switch settings with referring the Modification Note (P/N 08751-90034).
- 5. Reinstall the A1 and A2 boards.
- 6. Turn the HP 8751A, and confirm the following:
  - a. The "REV.4.02" is displayed.
  - b. The "POWER ON TEST FAILED" message is NOT displayed.
- 7. Turn the HP 8751A off. Reinstall the shield plate and the top cover.

SERVICE NOTE 8751A-14 Page 3

**Table 1. A1 ROMs (Rev.4.02)** 

Reference Designator	Part Number W/o Opt.002	Part Number W/ Opt.002
A1U43	08751-85901	08751-85611
A1U44	08751-85902	08751-85612
A1U45	08751-85903	08751-85613
A1U46	08751-85904	08751-85614
A1U47	N/A	08751-85615
A1U48	N/A	08751-85616

**Table 2. A2 ROMs (Rev.4.02)** 

Reference Designator	Part Number
A2U1	08751-85421
A2U2	08751-85422

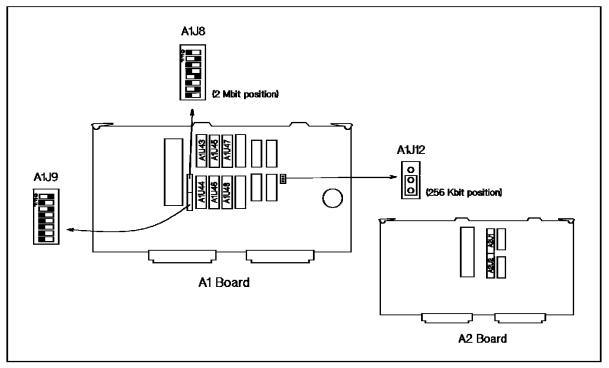


Figure 1. A1 and A2 Boards