

DSAV084A-02

Modification Recommended Service Note

Supersedes:
NONE

DSAV084A Infiniium Oscilloscope: 8GHz

Serial Numbers: MY00000000 / MY55170102

The Problem V-series scopes can shut down after the initial power on.

Parts Required:

P/N	Description	Qty.
NA		

ADMINISTRATIVE INFORMATION

ACTION ☐ ON SPECIFIED FAILURE		STANDARDS	
CATEGORY: X AGREEABLE TIME		LABOR: 1.0 Hours	
LOCATION ☐ CUSTOMER INSTALLABLE		SERVICE: ☐ RETURN	USED ☐ RETURN
CATEGORY: ☐ ON-SITE (active On-site contract required)		INVENTORY: ☐ SCRAP	PARTS: ☐ SCRAP
X SERVICE CENTER		☐ SEE TEXT	X SEE TEXT
☐ CHANNEL PARTNERS			
AVAILABILITY: PRODUCT'S SUPPORT LIFE		NO CHARGE AVAILABLE UNTIL: DEC 1 , 2017	
X Calibration Required		PRODUCT LINE: PL1A	
☐ Calibration NOT Required		AUTHOR: MRR	

ADDITIONAL INFORMATION: This action "RTF" should be taken on any failure of the listed serial numbers in effect.

Situation:

V-series scopes can shut down after the initial power on. Units that were originally manufactured had a component on the acquisition assembly loaded that should have not been loaded. The component is L305 and needs to be removed on both acquisition assemblies. V-Series units effected need to be Returned To the Factory for upgrade, please see serial numbers to determine if RTF process is required.

Solution/Action:

– V-series scopes that have serial numbers < MY55170103 if returned to local service centers for repair need to be transshipped to F03 for factory repair.

The factory will removed the L305 and test, calibrate unit to specifications return with Certificate of Calibration.

Revision History:

Date	Service Note Revision	Author	Reason for Change
01-DEC- 2016	01	Mark Rowley	As Published