

S E R V I C E N O T E

SUPERSEDES: NONE

E1437A VXI Digitizer

Serial Numbers: US00000000 / US37340402

External trigger improved.

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N	Description
E1437-69510	Exchange A10 assembly

Situation:

The external trigger does not function reliably with trigger pulses less than 300 nS or a square wave with a frequency lower than 20 Hz. The design has been modified on A10 assemblies with date code 3845 or greater to correct this problem.

Solution/Action:

Replace the A10 assembly with date code 3845 or greater.

DATE: January 2001

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	LABOR Hours
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: DWH	ENTITY: A100	AGILENT RESPONSIBLE UNTIL: January 2001	
		ADDITIONAL INFORMATION: PCO A1-9811007	

