

S E R V I C E N O T E

SUPERSEDES: None

E3631A Triple Output DC Power Supply

Serial Numbers:

KR53600100 / KR61601747 for 0E3 Option (230 Vac) (All serials KR61601747 and below for 0E3 Option (230 Vac))

New line fuse increases the in-rush current rating for option OE3 (230 Vac input)

To Be Performed By: Agilent-Qualified Personnel or Customer

Parts Required:

P/N	Description
2110-0982	Fuse 2A 250V

Situation:

The surge current of the E3631A power supply with opt 0E3 (230 Vac input) is higher than the anti-surge current limit of the installed line fuse. With this condition, the line fuse can be blown when the power supply is powered on and off.

Solution/Action:

Replace the installed line-fuse on the rear panel with P/N 2110-0982.

Old P/N	New P/N
2110-0587	2110-0982

DATE: August 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hours
LOCATION CATEGORY:	<input checked="" type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input checked="" type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AUTHOR: NKP	ENTITY: Y300	AGILENT RESPONSIBLE UNTIL: August 1998	
		ADDITIONAL INFORMATION:	