

S E R V I C E N O T E

SUPERSEDES: NONE

E4356A Telecommunications DC Power Supply

Serial Numbers: US39290101 / US39290164

Incorrect Capacitor on Control Board

To Be Performed By: Agilent-Qualified Personnel

Parts Required: C683 p/n 0160-5468

Situation:

A capacitor, C683, on the Control Board (p/n E4356-60020) has the wrong value. The current capacitor has a value of 2.2 uf. The value of the capacitor should be 0.47 uf, p/n 0160-5468. This change will improve the turn on slew rate.

Solution / Action:

For units returned for any reason in the specified serial number range, replace the specified capacitor with the correct capacitor.

DATE: November 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

MODIFICATION RECOMMENDED

ACTION CATEGORY:	IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME	STANDARDS:	LABOR 1.0 Hours	
LOCATION CATEGORY:	CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER	SERVICE INVENTORY:	RETURN SCRAP SEE TEXT	USED PARTS: RETURN SCRAP SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: End of Support Life		
AUTHOR: FJP	ENTITY: 2100	ADDITIONAL INFORMATION:		

