

E4980A-15

Information Only Service Note

Supersedes:
NONE

E4980A Precision LCR Meter, 20 Hz to 2 MHz

Serial Numbers:

E4980A - MY46516001 and above

E4980A GSA - SG46500501 and above

E4980AL - MY54304301 and above

E4980AL GSA - SG54300101 and above

Manufacturing ID Number: N/A

Firmware Update Before Replacing PPMC P0600 Board

Parts Required:

NONE

ADMINISTRATIVE INFORMATION

☐ Calibration Required
☒ Calibration NOT Required

PRODUCT LINE: WN
AUTHOR: BS

ADDITIONAL INFORMATION: PPMC Replacement procedure for Firmware Revision B.07.01

Situation:

E4980A/AL with the serial below will be using firmware revision B.xx.xx. Due to there's newer version in PPMC P0600 board, firmware B.07.02 and above is needed to support the new P0600. Initialization error will occur (instrument will not boot up) if the new P0600 is paired with firmware revision B.07.01.

E4980A - MY46516001 and above

E4980A GSA - SG46500501 and above

E4980AL - MY54304301 and above

E4980AL GSA - SG54300101 and above

Solution/Action:

Update E4980A/AL firmware to B.07.02 and above before replacing P0600 PPMC board.

Revision History:

Date	Service Note Revision	Author	Reason for Change
29 Mar 2018	01	BS	As Published