

S E R V I C E N O T E

SUPERSEDES: NONE

**E5022A Hard Disk Read / Write Test System
E8401A VXI Mainframe**

Serial Numbers:JP00000000 / JP2KF00187

Modification / Replacement to Correct Fan Power Supply Failing**To Be Performed By:** Agilent-Qualified Personnel**Parts Required:**

P/N	Description	Quantity
E8401-69276	RBLT 0950-3276 600W PWR SUPPLY	1

Situation:

A capacitor in the fan supply of the E8401A power supply is failing.

Solution / Action:

Option 1. Apply the service note E8401A-01 on-site.

Option 2. Modify the power supply as follows:

1. Detach the power supply (0950-3276) from the mainframe. Refer to "Replacing the E8401A Power Supply" in the "E8401A, E8403A User and Service Manual" for power supply removal instructions.
2. From the connector side, remove C111 capacitor with using two soldering irons. To prevent the connector from touching the irons, put a heat insulation sheet on the connector.
3. Restore the power supply to the mainframe.

DATE: October 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input checked="" type="checkbox"/> IMMEDIATELY <input type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours	
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input checked="" type="checkbox"/> ON-SITE <input type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY: <input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS: <input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		AGILENT RESPONSIBLE UNTIL: October 2001
AUTHOR: YO	ENTITY: 3355	ADDITIONAL INFORMATION:	

