S E R V I C E N O T E

SUPERSEDES: NONE

HP E5100A/B Network Analyzer Firmware Revision: 2.10 and below

Modification to fix "EQUCO?" command problem in admittance display format

To Be Performed By: HP-qualified personnel

Parts Required: Need one of the following firmware disks.

1. HP P/N E5100-180xx (FW DISK #509)

For: Firmware revision before modification REV.2.10 and below

Installed option Option 509

2. HP P/N E5100-181xx (FW DISK 1BW)

For: Firmware revision before modification REV.2.10 and below

LCD display type Black and white

Maximum number of sweep points 801 or 401

3. HP P/N E5100-182xx (FW DISK 1CL)

For: Firmware revision before modification REV.2.10 and below

LCD display type Color

Maximum number of sweep points 401

Continued

DATE: August 1998

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ HP LOCATION	SERVICE RETURN USED RETURN INVENTORY: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	HP RESPONSIBLE UNTIL: August 2000
AUTHOR: KI	ENTITY: 3300	ADDITIONAL INFORMATION:

© 1998 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



4. HP P/N E5100-183xx (FW DISK 2BW)

For: Firmware revision before modification REV.2.10 and below

LCD display type Black and white

Maximum number of sweep points 1601

5. HP P/N E5100-184xx (FW DISK 2CL)

For: Firmware revision before modification REV.2.10 and below

LCD display type Color Maximum number of sweep points 1601

Notes

"xx" should be the latest number.

(It must be "04" or later.)

"04" is assigned for firmware revision 2.11 in which the problem described in this service note was solved.

• Firmware revision 3.00 or later (HP P/N E5100-185xx) should NOT be installed into the HP E5100A/B which currently has firmware revision 2.xx or below without hardware modification.

Installing REV.3.xx without required hardware modification may cause serious trouble to the HP E5100A/B

To install the firmware revision 3.00 or later into theunit, the HP E5100A/B must be modified using a REV.3.xx upgrade kit.

That hardware modification is NOT covered by this service note.

Situation:

Sending "EQUCO?" command when the HP E5100A/B's display format is set to IYI (admittance) may return incorrect data. This problem is caused by a firmware bug on revision 2.10 and below, and it is fixed on revision 2.11.

Solution/Action:

This problem can be fixed by firmware update.

FIRMWARE UPDATE PROCEDURE

- 1-1. Press [System], {MORE}, {SERVICE MENU}, {FIRMWARE REVISION} to confirm that the unit has a firmware revision 2.10 and below.
- 1-2. Confirm that the firmware disk is correct one to update the firmware of the unit. (see the part list of "Parts Required:")
- 1-3. Turn OFF the unit.
- 1-4. While pressing [Preset] and [0] keys at the same time, turn ON the E5100A/B, and wait for a while until some {firmware update} softkey is appeared on the display,
- 1-5. Press {Firmware Update} softkey.
- 1-6. Insert the firmware disk into the floppy disk drive of the HP E5100A/B.
- 1-7. Press {OK} softkey.

- 1-8. Press {EXECUTE UPDATE} softkey.
- 1-9. Press {OK} softkey to start the firmware update.

Note: It will take several minutes to complete the firmware update.

When the firmware update is completed, the unit automatically execute preset operation.

FINAL OPERATION CHECK

- 2-1. Turn the E5100A/B ON and confirm that the unit passes power on selftest.
- 2-2. Press [System], {MORE}, {SERVICE MENU}, {EXECUTE TEST} to start self-diagnoses.
- 2-3. Confirm that the unit passes the self-diagnoses.