A MODIFICATION OR SAFETY COMMUNICATE

E5100A-29B

SERVICE NOTE

Supersedes: E5100A/B-29A

Agilent E5100A/B Network Analyzer

Serial Numbers: See below

Replacement of Floppy Disk Drive

Parts Required:

See below

Situation:

FDD (floppy disk drive) in E5100A/B was obsolete and replaced to a new FDD. Size of the new FDD is different from the old one.

Solution/Action:

To replace a FDD, use respective parts for each serial numbers.

1) For E5100A/B serial number:

E5100A (JP5KC01664 and above)

E5100B (JP1KC00408 and above)

Replacement Part

P/N Description Quantity

E5100-65006 FDD

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR: YH PRODUCT LINE: WN

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2005 PRINTED IN U.S.A.



Page 2 of 3 [SN number here]

2) For E5100A/B serial number: E5100A(JP1KC00101 / JP5KC01663) E5100B(JP1KC00101 / JP5KC00407)

Replacement Part

P/N	Description	Quantity
E5100-65003	FDD Kit	1

If the FDD Kit(E5100-65003) is out of stock, use the following parts;

P/N	Description	Quantity
E5100-65006	FDD	1
E5100-00221	Front Panel	1
E5100-01211	Cover, FDD	1
E5100-25004	Sponge, Side	1
E5100-25013	Sponge, Rear	1
E5100-61661	Flat Cable	1
0515-1048	Screw	3

To assemble the FDD cover with sponges, see attached figures.

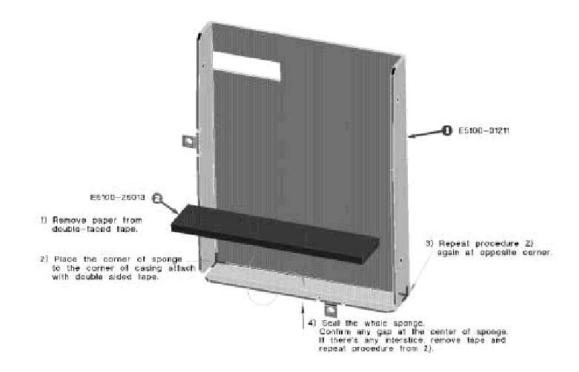


Figure 1

Page 3 of 3 [SN number here]

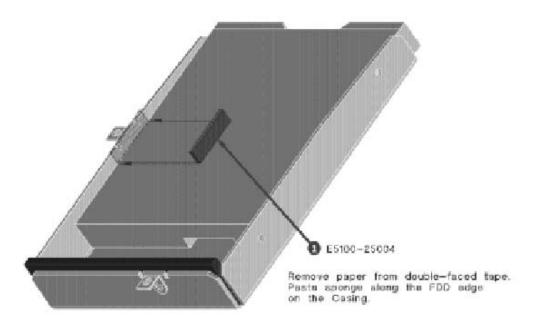


Figure 2.