

SAFETY – IMPLEMENTED DURING NORMAL COURSE
OF PROVIDING SUPPORT

N6777A-01-S

S E R V I C E N O T E

Supersedes:

N6777A DC Power Module, 150V, 2A, 300W

Serial Numbers: MY51000120 to MY51000377

POSSIBLE SHOCK HAZARD

WARNING

HAZARD CLASS 3

The web page served from these products to a web browser running Java 7 displays the incorrect output state.

Parts Required:

P/N	Description	Qty.
NONE		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
SAFETY		
ACTION CATEGORY: X AGREEABLE TIME	STANDARDS LABOR: 0.5 Hours	
LOCATION X CUSTOMER INSTALLABLE CATEGORY: <input type="checkbox"/> ON-SITE (active On-site contract required) X SERVICE CENTER <input type="checkbox"/> CHANNEL PARTNER	SERVICE <input type="checkbox"/> RETURN INVENTORY: <input type="checkbox"/> SCRAP X SEE TEXT	USED <input type="checkbox"/> RETURN PARTS: <input type="checkbox"/> SCRAP X SEE TEXT
AVAILABILITY: ALWAYS	NO CHARGE AVAILABLE UNTIL: EOS	
<input type="checkbox"/> Calibration Required X Calibration NOT Required	PRODUCT LINE: SP AUTHOR: PF	
ADDITIONAL INFORMATION: Customer installable with firmware upgrade		

© AGILENT TECHNOLOGIES, INC. 2013
PRINTED IN U.S.A.

June 21, 2013

Rev. 23



Situation:

The N6777A power supply's web page GUI when installed on N6700B/N6701A/N6702A Modular DC Power Supply mainframes will show the output state to be off when it is actually on and it may show a zero volt output when the voltage is non-zero. This occurs with either Internet Explorer or Firefox web browsers that are running Java 7 on a Windows based PC. This problem does not appear on the front panel of the power supply, the SCPI programming interface, nor with a web browser running previous versions of Java.

The N6777A can produce hazardous voltages and Agilent requests that the firmware be updated as soon as possible.

Solution/Action:

1. Verify that your instrument(s) corresponds to the above model.
2. Check that the power supply's mainframe firmware is version D.01.09 or lower. This can be done using one of the IO interfaces and sending the "*IDN?" query. If firmware version is D.02.01 or above, you do not need to do anything further.
3. If the firmware version is D.01.09 or lower, do not use the affected unit under the hazardous condition described above and continue with step 4.
4. Download the latest firmware utility and perform the firmware upgrade to version D.02.01 and above. Use web link to download firmware utility and latest firmware revision for N6700 Series Modular DC Power Supply mainframes. <http://www.agilent.com/find/n6700firmware>

Revision History:

Revision Number	Date	Author	Reason For Change
1.0	6/17/2013	PF	As published