

S E R V I C E N O T E

SUPERSEDES: None

16380C Standard Capacitor Set

Serial Numbers: 2519J00224 / 2519J00497

Modification prevents potential damage to the carrying case

Duplicate Service Notes: None

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

Part No.	Qty.	Description
16380-89201	1	Block, Foamed Urethane
or		
16380-85104	1	Carrying Case

Situation:

It is possible that a number of 16380C Standard Capacitor Set have been shipped with missing a plastic (foamed urethane) part in a vacant space of the carrying case (See Figure 1, part B). The plastic part is invisible from outside, but this may cause mechanical damage to the standard capacitor.

Continued

DATE: 18 February 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS:	Labor 0.5 Hour
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	USED PARTS:	<input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input checked="" type="checkbox"/> SEE TEXT
AUTHOR: YO	ENTITY: 3355	AGILENT RESPONSIBLE UNTIL: February 1995	
		ADDITIONAL INFORMATION:	

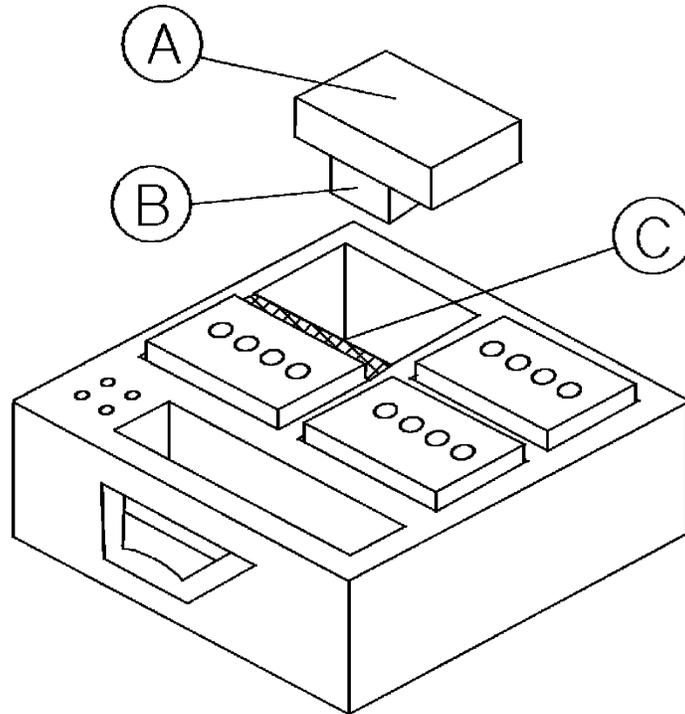


Figure 1.

Solution/Action:

Check the carrying case by pushing down part A in Figure 1 with your finger. If part A sinks, replace the block with the new one (P/N 16380-89201).

If the partition of the carrying case (part C) is broken, replace the whole carrying case with the new one (P/N 16380-85104)