



Agilent 70810B Lightwave Section: System Improvements for Agilent 71400C and 71401C Lightwave Signal Analyzers

The Agilent 70810B lightwave section significantly enhances the capabilities of the Agilent 71400C and 71401C lightwave signal analyzers. Unlike the Agilent 70810A, which operated as a master module within the modular measurement system (MMS), the Agilent 70810B is a slave module to the MMS local oscillator. This important difference allows the user to access and utilize the functions available in the electrical spectrum analyzer in MMS.

This product note summarizes key differences of Agilent 71400C and 71401C lightwave signal analyzers, when configured with the Agilent 70810A and 70810B lightwave sections. Key differences covered in this product note include:

- * New features
- * Measurement enhancements
- * Menus
- * System configuration
- * Remote commands

For complete information on the operation of Agilent 71400C and 71401C lightwave signal analyzers, refer to the Agilent 70900B Local Oscillator Operation and Programming manuals.

New Features

The Agilent 70810B lightwave section adds the following features to the Agilent 71400C and 71401C lightwave systems:

Downloadable program (DLP): A DLP is a program that can be written or loaded into the lightwave signal analyzer. DLPs allow the the analyzer to perform simple to very complex tasks or calculations without an external controller. The RINLasr DLP is an example of such a program.

Memory card reader: The memory card reader is an interface built into the Agilent 70004A display, which allows traces, states, and DLPs to be read from or stored on ROM and RAM cards.

The HP-HIL keyboard interface: The interface allows the user to enter commands and titles into the analyzer from the keyboard.

Screen titles: Screen titles are comments entered by the user, which are displayed on the analyzer screen.

Mass storage to an external disk: Allows the user to save/recall state and trace information, store computed data, and load DLPs directly onto an external disk drive.

Limit lines: Limit lines can be created to allow conditional testing in pass or fail measurements.

Panning: This feature allows positioning of start frequency, stop frequency, center frequency, and span without waiting for the analyzer to complete a trace sweep.

Operates with non-lightwave modules: When present in the lightwave system, the Agilent 70810B operates with other Agilent 70900B local oscillator compatible modules.

Measurement Enhancements

RIN measurement enhancements—A DLP (RINLasr) is included with the signal analyzer. This program measures the RIN of lasers to –165 dB/Hz by subtracting the receiver shot noise and thermal noise contributions from the total system noise. (See Product Note 71400-1, literature number 5091-2196E.)

The value of RIN is always displayed in electrical units independent of the display mode of operation. Therefore, the same RIN value is obtained whether the instrument is operating in lightwave electrical or optical mode.

RIN can be measured independently of the average power bar. A valid measurement can be obtained with the power bar off the top of the screen.

Relative power is independent of the power bar—Measurement of relative power (REL PWR key) is now independent of the power-bar display.

Linear lightwave display—A linear graphic display is available when the lightwave input is selected. When LW MODE Opt is selected, the linear display is in power units. However, when LW MODE Elec is selected, the linear display can be in either power or voltage units.

Independent lightwave mode annotation—Display trace units have been decoupled from the optical average-power-meter bar, which allows trace information to be displayed in lightwave-electrical units and the optical-power meter information to be displayed in lightwave-optical units.

New LW MODE Elec reference plane—The lightwave electrical-mode measurement now takes into account the effects of the built-in preamplifier following the photodetector. (See figure 1.) Figure 1 shows the lightwave optical reference plane A, the new lightwave electrical reference plane B, and the old (Agilent 70810A) lightwave electrical reference plane C.

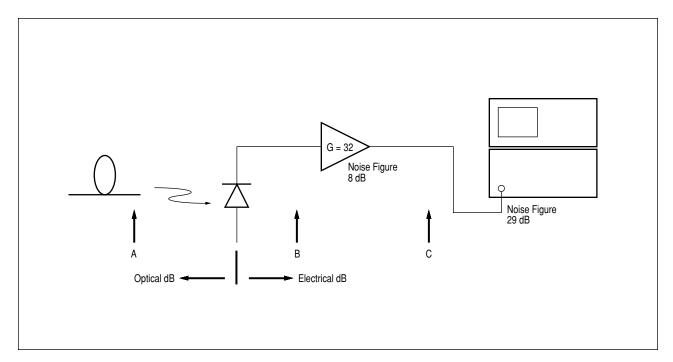


Figure 1. Lightwave-electrical mode reference plane change.

Wide USRPWR adjustment range—The USRPWR function allows the Agilent 71400C signal analyzer to be referenced to another calibrated optical-power standard. As such, this function is useful in correcting for optical connector insertion loss or uncertainty and permits the Agilent 71400C to be calibrated at a non-factory calibrated wavelength. The user power adjustment range can now be extended. The range extends from ± 2 dB from factory calibration point to ± 300 dB.

Menus

The menus of the Agilent 71400C and 71401C lightwave signal analyzers are now similar to those of the Agilent 70000 spectrum analyzer. Major changes to the user interface are described below:

Switch from LW optical to LW electrical mode—To switch the display units from lightwave-optical units to lightwave-electrical units, press:

Amptd; more, LW MODE Elec

Select between LW and RF inputs to the Agilent 70810B—Press:

State; select mode, IN 2 uW 70810B or IN 1 LW 70810B

Control average optical-power meter—To turn the power-meter display on or off, adjust the display units, or apply a user-power offset, a new key has been added. Press:

Amptd; more, power meter, PWR MTR On Off

PWR MTR ElecOpt USR PWR On Off

Change calibration wavelength—To change the factory calibration wavelength from 1300 nm to 1550 nm, press:

Amptd; more, LAMBDA [1550 nm] or use the arrow key up

RIN measurements—The Agilent 71400C and 71401C will perform two RIN measurements: RIN_{system} (RINSYS) and RIN_{laser} (RINLasr). RINSYS, the RIN function of the Agilent 70810A, provides the ratios of laser noise, shot noise, and thermal noise to the average optical power. Press:

Marker; RIN SYS On

RINLasr provides enhanced measurement capability by subtracting the signal analyzer shot noise and thermal noise. Press:

USER; RINLasr

Display annotation—The following changes have been made to the display annotation:

- LW MODE indicator is to the right of the ATTEN annotation.
- Zeroing indicator is an asterisk (*) to the right of the AVG PWR annotation.
- USRPWR indicator is an asterisk (*) to the left of the AVG PWR indicator.
- AVG PWR unit indicator follows the numeric AVG PWR indicator.

System Configuration

Default address—Now that the Agilent 70810B is a SLAVE to the Agilent 70900B local oscillator, its default address has changed. When the Agilent 71400C or 71401C lightwave signal analyzers ship from the factory, the default address of the Agilent 70810B is row 3, column 20 (as shown in figure 2). Figure 2 also shows the default address map for the Agilent 70810A as configured in the lightwave signal analyzers.

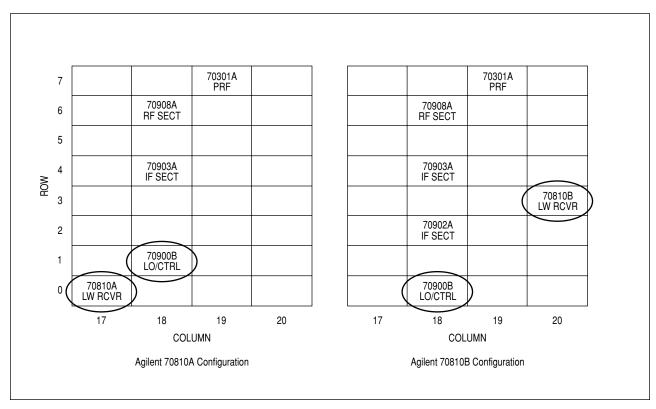


Figure 2. Configuration changes for the Agilent 71400C and 71401C lightwave signal analyzers.

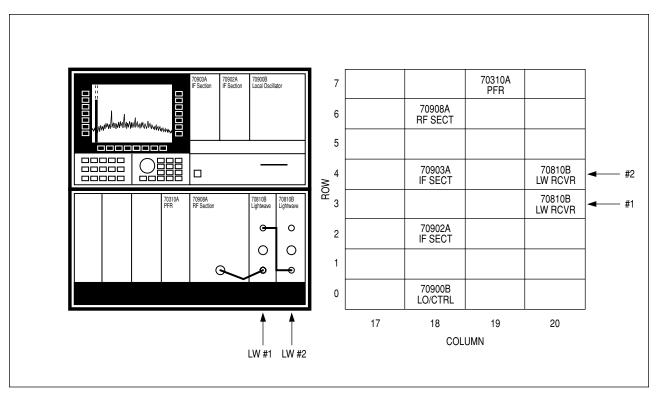


Figure 3. Multiple lightwave section addresses and system configurations.

Sensitivity and flatness degradation in the second lightwave section is due to the bypass switch. Also, only one system calibration is supported. Characteristic flatness in optical dB of the second lightwave section is listed below:

Frequency Range	Agilent 71400C Specifications	Agilent 71400C + 70810B Characteristics
100 kHz - 2.9 GHz	+ 1 dB	+ 1.4 dB
$2.9~\mathrm{GHz} - 6~\mathrm{GHz}$	+ 1 dB	+ 1.5 dB
$6~\mathrm{GHz} - 12~\mathrm{GHz}$	+ 1 dB	+ 1.7 dB
12 GHz – 16 GHz	+ 1 dB	+ 1.9 dB
$16~\mathrm{GHz} - 22~\mathrm{GHz}$	+ 1 dB	+ 2.0 dB

Remote Commands

The following table describes the changes in remote programming between the Agilent 70810A and the 70810B lightwave sections. If the command is not listed, it has not been affected by the module change. All new commands supported by the Agilent 70810B lightwave signal analyzer are listed in the Agilent 70900B Local Oscillator Programming manual.

Note: All system programming must directly address the Agilent 70900B local oscillator (LO) and not the lightwave section.

COMMAND	COMMENTS	
AUNITS	The AUNITS OPTICAL and ELECT options have been replaced with the new OPTMODE command.	
CAL	The CAL options listed below have been replaced with the following new commands:	
	CAL OPTPWR ————————————————————————————————————	
CALCOR	The CALCOR options listed below have been replaced with the following new commands:	
	CALCOR OPTPWR ————————————————————————————————————	
LAMBDA	LAMBDA, a new command, is used to select the wavelength of operation: The wavelength of operation is 1300 or 1550 nm for the Agilent 70810B.	
LN	$LN\ (linear)\ supports\ two\ optional\ arguments,\ V\ or\ W,\ to\ specify\ the\ type\ of\ linear\ scale.$ The V scale is not allowed for LW MODE Opt.	
LTWAVE	LTWAVE has been replaced with the INPUT command.	
MKD?	MKD? query command has been replaced by the MKF? command.	

MKRELPWR command is supported by the Agilent 70810B, but is no

longer dependent upon the marker-delta function.

RIN? The RIN? command performs the following tasks:

Activates the RINLasr DLP
 Runs a single measurement

3) Returns, values for RIN laser, RIN system, thermal-noise term, and

shot-noise term in that order.

MKRIN is not supported by the Agilent 70810B. Use RIN? and

MKRINSYS for alternate RIN commands.

MKRINSYS is a new command for the MKRIN command, but is not

dependent upon the marker-delta function.

OPTCOR OPTCOR is not supported by the Agilent 70810B.

OPTMODE is a new command that replaces the OPTICAL and ELECT

options of the AUNITS command.

PWRBARON PWRBARON is a new command that controls the presence or absence of

the power-bar display.

PWRMODE is a new command that selects either optical or electrical

units for the power bar.

RQS, SRQ, STB These commands are available, but status-bit definitions have changed.

Bit 1 (message bit) includes condition of power-bar zeroing.

Bit 3 (previously available) is not used.

Bit 5 (error bit) includes power-bar out-of-range.

Bit 7 (previously available) is not used.

SWCOR is not supported by the Agilent 70810B.

For more information, order the latest version of the

Lightwave Test & Measurement Catalog.

For more information about Agilent Technologies test and measurement products, applications, services, and for a current sales office listing, visit our web site,

www.agilent.com/comms/lightwave

You can also contact one of the following centers and ask for a test and measurement sales representative.

United States:

Agilent Technologies Test and Measurement Call Center P.O. Box 4026 Englewood, CO 80155-4026 (tel) 1 800 452 4844

Canada:

Agilent Technologies Canada Inc. 5150 Spectrum Way Mississauga, Ontario L4W 5G1 (tel) 1 877 894 4414

Europe:

Agilent Technologies
Test & Measurement
European Marketing Organization
P.O. Box 999
1180 AZ Amstelveen
The Netherlands
(tel) (31 20) 547 2000

Japan:

Agilent Technologies Japan Ltd. Call Center 9-1, Takakura-Cho, Hachioji-Shi, Tokyo 192-8510, Japan (tel) (81) 426 56 7832 (fax) (81) 426 56 7840

Latin America:

Agilent Technologies Latin American Region Headquarters 5200 Blue Lagoon Drive, Suite #950 Miami, Florida 33126, U.S.A. (tel) (305) 267 4245 (fax) (305) 267 4286

Australia/New Zealand:

Agilent Technologies Australia Pty Ltd 347 Burwood Highway Forest Hill, Victoria 3131, Australia (tel) 1-800 629 485 (Australia) (fax) (61 3) 9272 0749 (tel) 0 800 738 378 (New Zealand) (fax) (64 4) 802 6881

Asia Pacific:

Agilent Technologies 24/F, Cityplaza One, 1111 King's Road, Taikoo Shing, Hong Kong (tel) (852) 3197 7777 (fax) (852) 2506 9284

Technical data subject to change Copyright © 1991, 2000 Agilent Technologies Printed in U.S.A. 7/00 5091-2324E

