

**86100B-01**

# S E R V I C E                      N O T E

Supersedes:  
NONE

## **86100B Infiniium DCA Oscilloscope Mainframe**

**Serial Numbers: All**

**New part number for A17 CD ROM Drive is 0950-4373. If replacing A17 P/N 0950-4192, requires addition of 0 ohm resistor to A15 CD ROM Adapter Board.**

**Parts Required:**

<b>P/N</b>	<b>Description</b>	<b>Qty.</b>	
0699-2643	Resistor Fixed 0 Ohm	1	(or equivalent)
0950-4373	DISC DRIVE - 24X CD ROM	1	

**Situation:**

A17 CD ROM Drive P/N 0950-4192 was discontinued and replaced with 0950-4373. However, the new CD ROM drive requires a 0 ohm resistor to be added to the A15 CD-ROM

## **ADMINISTRATIVE INFORMATION**

SERVICE NOTE CLASSIFICATION:

**INFORMATION ONLY**

AUTHOR: RBS      PRODUCT LINE: 8F

ADDITIONAL INFORMATION: ECR0004130 / ECO0021395

Adapter board P/N 86100-66517. If replacing CD ROM P/N 0950-4192 with P/N 0950-4373, modify A15 as follows.

**Solution/Action:**

1. Solder 0 Ohm resistor (P/N 0699-3574) to R1 of A15 CD Rom Adapter Board, P/N 86100-66517.

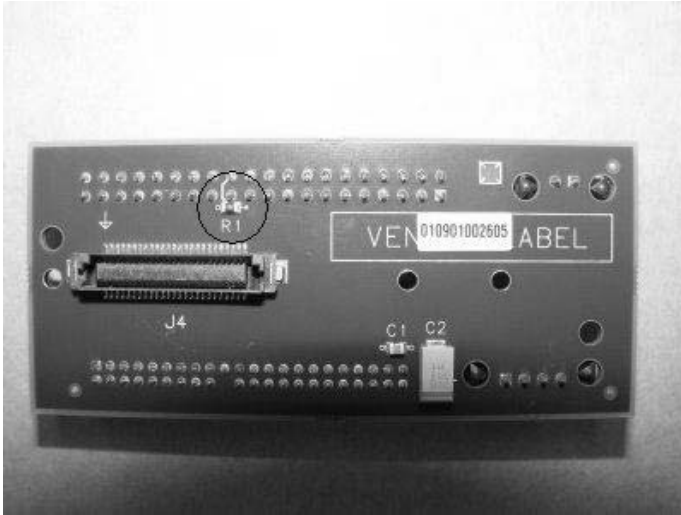


Figure 1 – Location of R1 (0 ohm resistor) on A15 CD ROM Adapter Assembly

2. Install the CD ROM Adapter board to the rear of the CD drive as shown.



Figure 2 – A15 and A17 assemblies.

END.