

INFORMATION ONLY – DOES NOT COMMUNICATE
A MODIFICATION OR SAFETY CONDITION

E5100B-29B

S E R V I C E N O T E

Supersedes:
E5100A/B-29A

Agilent E5100B Network Analyzer

Serial Numbers: See below

Replacement of Floppy Disk Drive

Parts Required:
See below

Situation:

FDD (floppy disk drive) in E5100A/B was obsolete and replaced to a new FDD. Size of the new FDD is different from the old one.

Solution/Action:

To replace a FDD, use respective parts for each serial numbers.

- 1) For E5100A/B serial number:
E5100A (JP5KC01664 and above)
E5100B (JP1KC00408 and above)

Replacement Part

P/N	Description	Quantity
E5100-65006	FDD	1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR: YH PRODUCT LINE: WN

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2005
PRINTED IN U.S.A.



Agilent Technologies

June 7, 2005

2) For E5100A/B serial number:
 E5100A(JP1KC00101 / JP5KC01663)
 E5100B(JP1KC00101 / JP5KC00407)

Replacement Part

P/N	Description	Quantity
E5100-65003	FDD Kit	1

If the FDD Kit(E5100-65003) is out of stock, use the following parts;

P/N	Description	Quantity
E5100-65006	FDD	1
E5100-00221	Front Panel	1
E5100-01211	Cover, FDD	1
E5100-25004	Sponge, Side	1
E5100-25013	Sponge, Rear	1
E5100-61661	Flat Cable	1
0515-1048	Screw	3

To assemble the FDD cover with sponges, see attached figures.

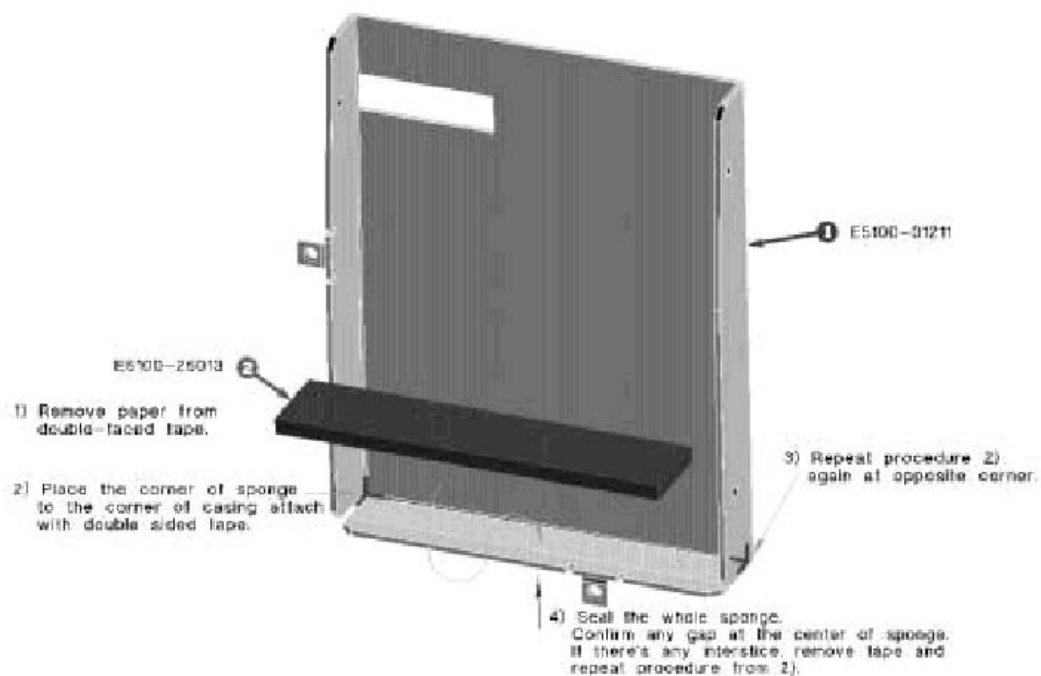


Figure 1

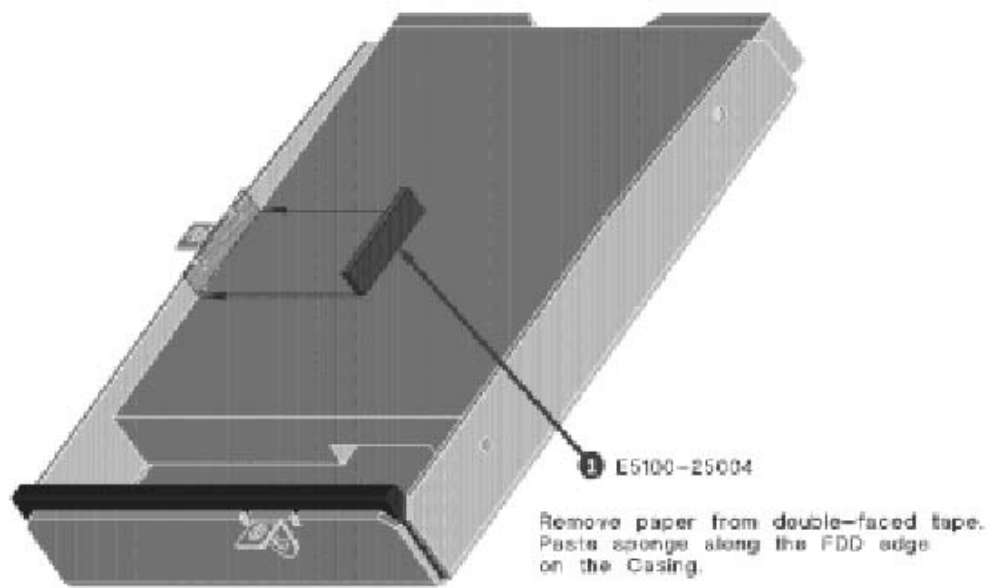


Figure 2.