


Low Frequency RFID Tag Characterization Using the Agilent N9322C Basic Spectrum Analyzer (BSA)

Abstract

The resonance frequency of a radio frequency identification (RFID) tag is a key factor that determines the effective radio communication distance between the tag and the reader. Measuring the resonance frequency of an RFID tag is easy using the Agilent N9322C basic spectrum analyzer (BSA).

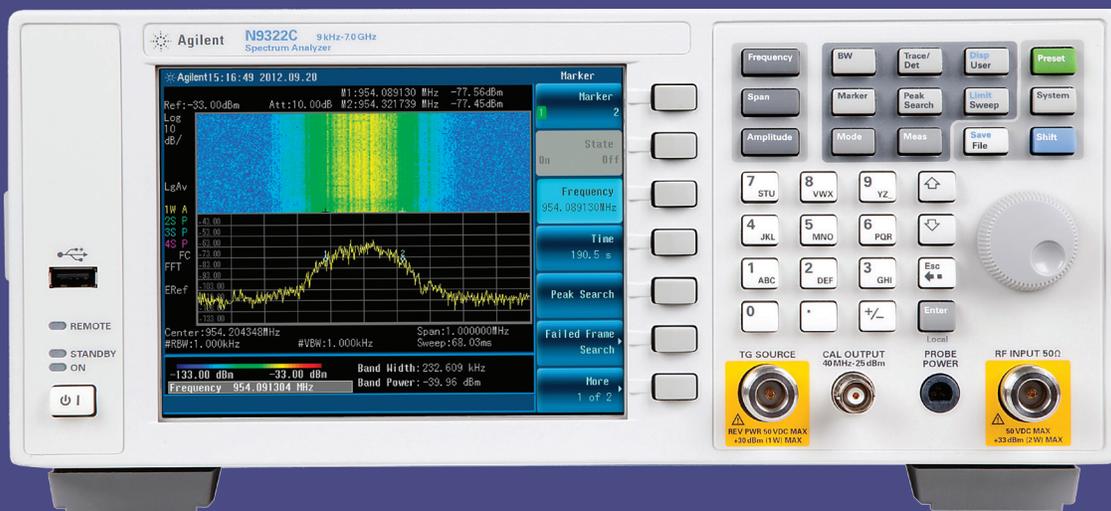

About RFID Tags

Radio frequency ID (RFID) systems rely on RFID tags, which are small transponders (a combined radio receiver and transmitter) that transmit identity information over a short distance when asked. Generally, an RFID tag contains two parts. One is an integrated circuit for storing and processing information, and modulating and de-modulating an RF signal. Another part is an antenna for receiving and transmitting signals to the reader (see Figure 1).

The resonance frequency of the RFID tag is one of the key factors that impact the effective communication distance between the reader and RFID tags. When RFID tags are packaged, a non-contact coupling method can be used to measure their resonance frequencies, which corresponds to the negative peak of its return loss characteristic curve.

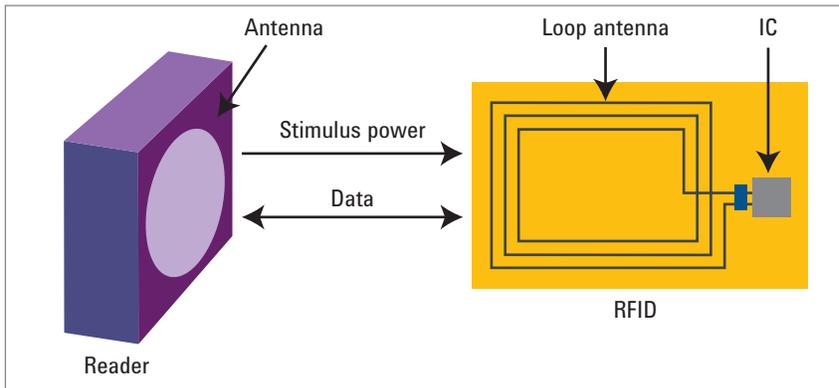


Figure 1. An overview of an RFID system

Measuring a 13.56 MHz Passive RFID Tag with the N9322C Basic Spectrum Analyzer (BSA)

The N9322C is a multi-use RF analyzer that spans to spectrum analysis, transmission measurement, and reflection measurement. By simply adding the tracking generator (Option TG7) and the reflection measurement application (Option RM7), the N9322C BSA is capable of measuring the return loss of RFID tags:

- The Option TG7 tracking generator contains a built-in VSWR bridge, which makes the reflection measurement more convenient to perform using the N9322C BSA versus using other analyzers that require an external bridge.
- In addition, the N9322C's reflection measurement mode uses a high precision open-short-load (OSL) calibration procedure, which greatly reduces system errors.

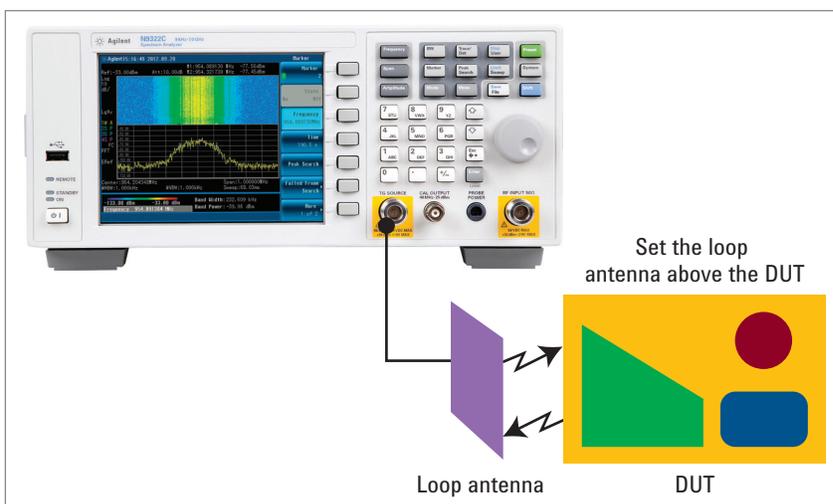


Figure 2. Simple test setup for reflection measurements

Demonstration: Measuring an RFID Tag with the N9322C BSA

- In this demonstration, we utilized a 13.56 MHz RFID tag, which follows the ISO/IEC 14443 type A standard.
- In the following demonstration procedure, text in [] refers to a hardkey and { } refers to a softkey on the N9322C spectrum analyzer
- Instrument and accessories used in this demonstration include:
 - N9322C basic spectrum analyzer (BSA), with Options TG7 and RM7 enabled
 - N9311X-201 precision mechanical open-short-load (OSL) calibrator
 - Near field probe (used for radiating RF power from the tracking generator to activate the RFID tag)
 - A sample RFID tag (13.56 MHz)
 - E5071C ENA network analyzer (used to compare the measurement result to that obtained using the N9322C)

Step 1. Set up the measurement parameters

- Press [Mode] > {Reflection measurement}
- Press [Frequency] > {Start Freq} > [12] > {MHz} to set the start frequency to 12 MHz
- Press [Frequency] > {Stop Freq} > [15] > {MHz} to set the stop frequency to 15 MHz
- Toggle the {Cal. Type} to {Selected} in order to achieve the highest calibration accuracy within the frequency range of interest

Step 2. Calibrate the N9322C BSA

- Press {Calibrate} and follow the instructions on the BSA to calibrate with the OSL calibrator (product number: N9311X-201)
- When finished, a “Calibrated” mark displays in the left upper corner of the screen
- Press [Amplitude] > {Scale/DIV} > [2] > {dB} to display the amplitude scale for easier observation

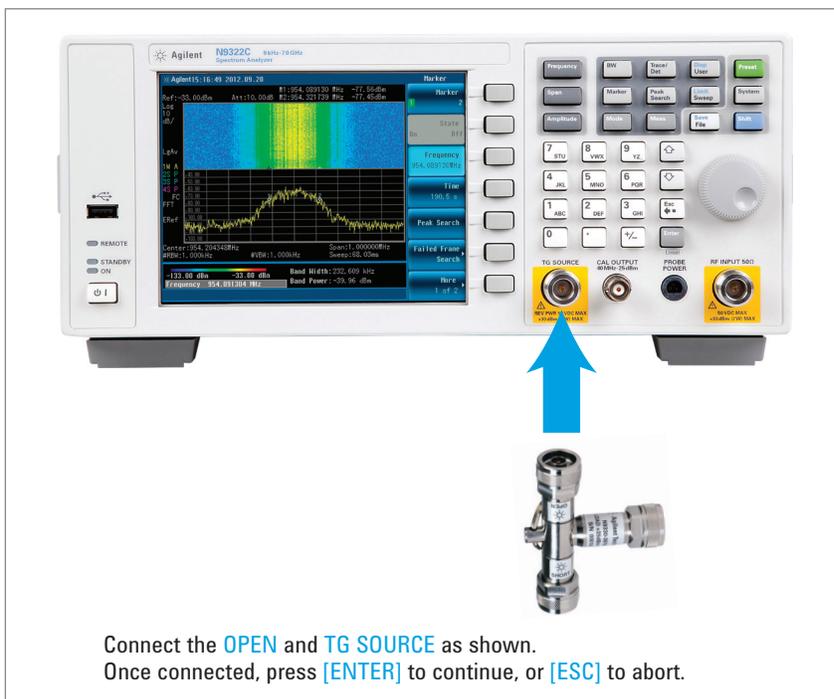


Figure 3. Performing OSL calibration on the N9322C BSA

Step 3. Start measurement using a near field probe

- Connect the near field probe to the TG Output port of the N9322C BSA, and place the probe about 1 cm (0.4 in) above the sample RFID tag (see Figure 4)
- Use the Marker on the N9322C BSA to read the negative peak of the trace. You can also verify the measurement result using an E5071C ENA (see Figures 5 and 6)

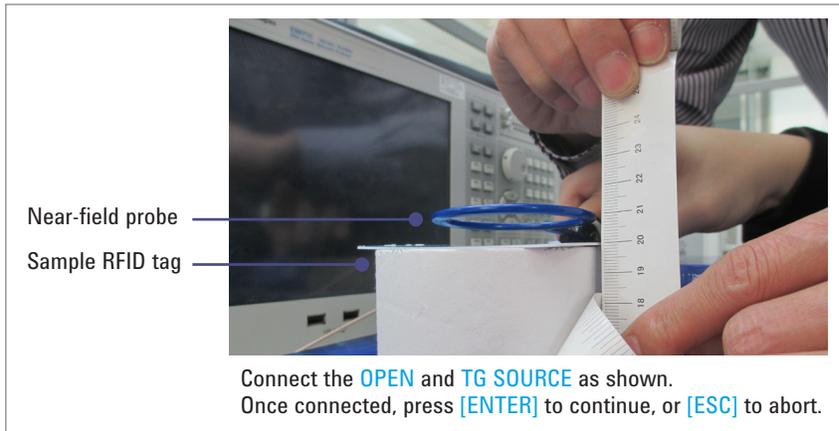


Figure 4. Use a close-field probe as the power radiator and collector

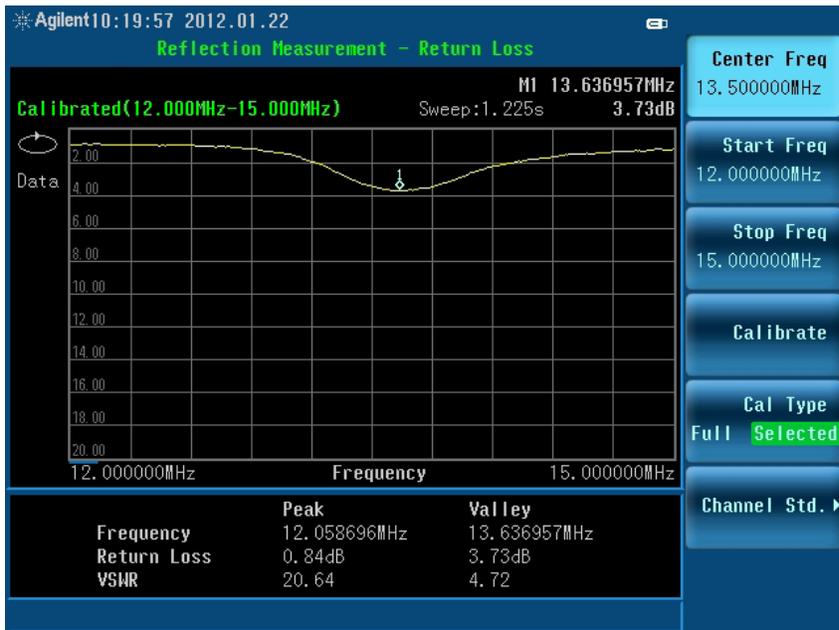


Figure 5. Return loss result measured with the N9322C BSA

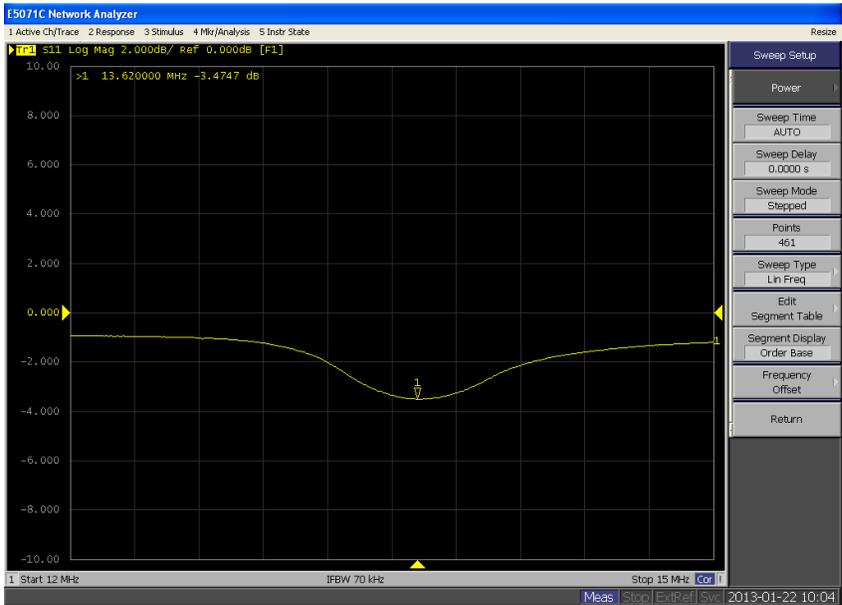


Figure 6. Return loss result measured with E5071C ENA

In order to get consistent measurement results between the N9322C BSA and E5071C ENA it is important the following items are set identically on both instruments:

- Output power level
- Number of trace points and amplitude scale
- Calibrator to implement the OSL calibration

Summary

The N9322C basic spectrum analyzer (BSA) is a cost-effective and multi-use RF analyzer. It offers general purpose spectrum analysis, and also expands to one-port vector network analysis with the optional tracking generator and its built-in VSWR bridge.

In the RFID design process, you can easily measure the frequency and power output from the reader with the N9322C BSA. Using the tracking generator (Option TG7) and reflection measurement application (Option RM7), you can also address the return loss test needs of the tags.

Ordering Information

Product number	Description
N9322C	Basic spectrum analyzer, 9 kHz to 7 GHz
N9322C-TG7	Tracking generator, 5 MHz to 7 GHz
N9322C-RM7	Reflection measurement
N9311X-201	3-in-1 precision mechanic calibrator



myAgilent

www.agilent.com/find/myagilent

A personalized view into the information most relevant to you.

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

Agilent Education Corner

www.agilent.com/find/edu

Your one-stop education resource for college and university engineering educators, researchers and students.



Three-Year Warranty

www.agilent.com/find/ThreeYearWarranty

Agilent's combination of product reliability and three-year warranty coverage is another way we help you achieve your business goals: increased confidence in uptime, reduced cost of ownership and greater convenience.



Agilent Advantage Services

www.agilent.com/find/AdvantageServices

Accurate measurements throughout the life of your instruments.



www.agilent.com/quality

www.agilent.com
www.agilent.com/find/n9322c

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at: www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 45 80 12 15
Finland	358 (0) 10 855 2100
France	0825 010 700* *0.125 €/minute
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 118 927 6201

For other unlisted countries:

www.agilent.com/find/contactus

(BP-3-1-13)

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2013
Published in USA, May 16, 2013
5991-2061EN



Agilent Technologies